

1

2

3

4

5


6

CLAMPING INSERTS FOR MACHINE VISES

■ Prism inserts, vertical and horizontal prism, longitudinal recess, hardened and ground



Code No.	S	L1	L2	L3	L4	L5	L6	L7	L8	L9	L10	D	D1	Clamping range Ø vertical d1	Clamping range Ø horizontal d2	For Type
	[mm]															
7-290-104	100	32.4	18	70	14	14.8	26	4	13.5	10.3	4.0	9	15	8-50	6-24	6512. 6537. 6530
7-290-105	125	40.0	22	85	17	18.6	32	4	16.0	12.6	4.0	11	18	11-70	8-30	6512. 6537. 6530
7-290-106	160	50.4	24	110	20	20.6	42	4	16.6	13.0	4.6	11	18	14-95	9-35	6512.6537 6515.6516 6530
7-290-108	200	63.0	30	140	28	25.0	55	4	21.0	16.0	4.0	14	20	18-123	12-44	6512.6537 6515.6516 6522
7-290-1050	125	42.0	22	89	18	18.6	34	4	16.0	12.6	4.0	11	18	11-70	8-30	6515.6516

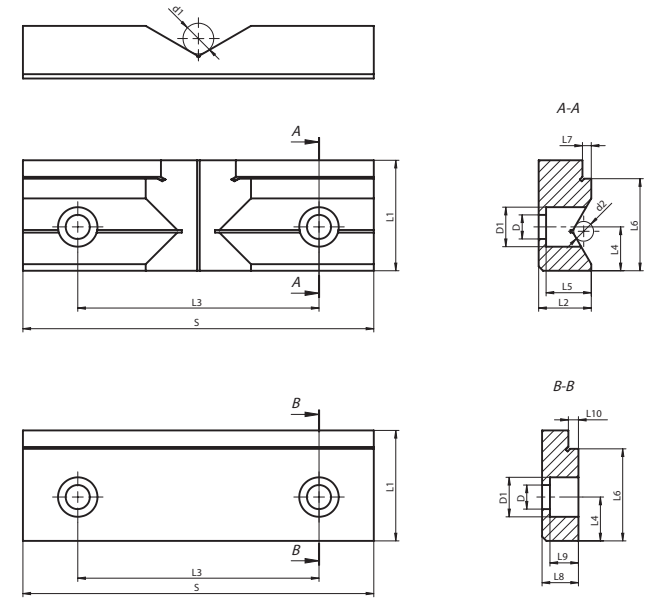


2-pc/set

CLAMPING INSERTS FOR MACHINE VISES

■ Prism inserts, vertical and horizontal prism, longitudinal recess, hardened and ground



Code No.	S	L1	L2	L3	L4	L6	L7	L8	L9	D	Clamping range Ø		For Type
											vertical	horizontal	
	[mm]										d1	d2	
7-292-104	100	32.4	18	63	14.0	26	4	13.5	4.0	M8	8-50	6-24	6517. 6518
7-292-105	125	40.0	22	80	15.8	32	4	16.0	4.0	M10	11-70	8-30	6517. 6518
7-292-106	160	50.4	24	100	20.0	42	4	16.6	4.6	M12	14-95	9-35	6517. 6518
7-292-108	200	63.0	30	125	25.0	55	4	21.0	4.0	M12	18-123	12-44	6517. 6518

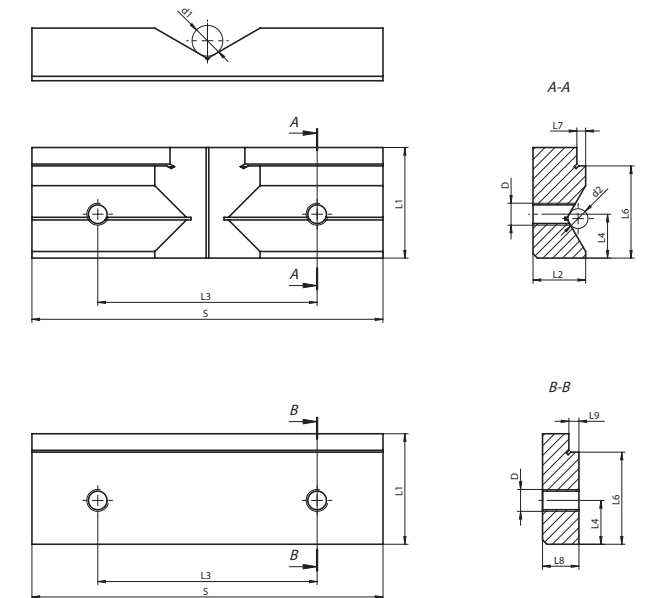

2-pc/set